

Analysis Of Water Status Quality And Flood And Innundation

by R Riduan

Submission date: 20-Apr-2023 06:46AM (UTC-0400)

Submission ID: 2070207102

File name: . _Analysis_Of_Water_Status_Quality_And_Flood_And_Innundation.pdf (1.02M)

Word count: 4669

Character count: 23292

Analysis Of Water Status Quality And Flood And Innundation Causes In Rawa Matang Hanau Irrigation Area Balangan District

Chandra Wahyu Sulistyo¹, Rony Riduan^{2,*}, and Hafiizh Prasetya³
¹ Master Program in Civil Engineering, Department of Swamp Resource Management, Faculty of Engineering, Lambung Mangkurat University, Banjarmasin, Indonesia

² Department of Environmental Engineering, Faculty of Engineering, Lambung Mangkurat University, Banjarbaru, Indonesia.

³ Department of Environmental Engineering, Faculty of Engineering, Lambung Mangkurat University, Banjarbaru, Indonesia.

Corresponding Author : Chandra Wahyu Sulistyo

Abstract: Matang Hanau is an irrigated swamp area located in Lampihong District, Balangan Regency this will be developed into a swamp irrigation area. The area is inhabited by transmigratory community with oil palm gardening as their livelihood. The plantations products obtained were unsatisfactory because the land was often flooded due to flooding that often occurs during the rainy season. The transmigratory community is also challenged with the clean water problem for their daily needs. The community must fulfill their need for drinking water by buying from outside the transmigratory area. Whereas bathing and washing, they use water in the existing channel of the swamp irrigation. On channels where people use the water, there are cages of chicken and cattle farms, so that the water used by the community has been polluted by the waste of chicken and cattle farms. Along with the use of water in these channels, health problems such as skin diseases arise.

This study analyzes the status of the channel's water quality by using the pollution index method and analyzes the causes of floods and inundation. Research regarding the causes of flooding and inundation was taken using the QGIS application with the RiverGIS plugin to model channel geometry which is then analyzed using the Hec-Ras application to determine the hydrodynamic model on the channel. The analysis results of the water status quality by the pollution index method suggested that the water in the swamp irrigation channel was highly polluted. Analysis of the causes of flooding and inundation on the existing channel to the flood debit plan with a return period of 1 year, 2 years, 5 years, and 10 years gives the results that the existing channel section is unable to accommodate the smallest flood debit that occurs at 2 years return of 10.94 m³/sec, thus causing flooding due to the water levels that exceed the depth of the channel so that it floods the plantation area. Based on the study results, the existing channel must be redesigned in order to accommodate the largest flood debit with a 10-year return period of 14.66 m³/sec. It was then analyzed by Hec-Ras where it shows the hydrodynamic model of the channel crossing to the largest flood debit plan.

Keywords: Matang Hanau, QGIS, RiverGIS, Hec-Ras, Flood

I. Introduction

The irrigated swamp area of Matang Hanau is a transmigratory area of Papuyuan, which is inhabited by approximately two hundred family heads from various regions outside of Kalimantan. The transmigratory community has oil palm plantations as their livelihood. Since 2014 until now, their outcome from oil palm plantations was not optimal because the plantation land can no longer be cultivated or functioned due to the flooded land (Edinayanti, 2018).

Due to this condition, transmigratory communities of Lajar Papuyuan find that it is difficult to plant crops. Another problem faced by transmigratory communities in Lajar Papuyuan is accessibility to clean water. They were forced out of the transmigratory area to meet their needs of clean water for cooking and drinking by buying it. Whereas for bathing and washing, they use water in the channel even though it has polluted with human and livestock wastes such as chickens and cattle (Edinayanti, 2018).

* Corresponding author: ronyrdn@ulm.ac.id

26

II. Theoretical Review

6

Government Regulation of Republic of Indonesia No. 82 (2001) states that "Water is one of the natural resources that has a very important function for human life and life, as well as to promote general welfare, so that it is the basic capital and the main factor of development". The bad quality water will result in bad environmental conditions that will affect the humans health and safety and the lives of other living beings.

State Minister of Environment (2003), through the Decree of the Minister of Environment No. 115 of 2003 explains that "water quality is a condition of water quality measured and / or tested according to certain parameters and certain methods based on the applicable legislation". The status of water quality can be defined as the level of water quality conditions that indicate pollutant conditions or good conditions in a water source within a certain time by comparing it with the established quality standards (Ministry of Environment 2003). The established quality standard is standard that has been determined based on Government Regulation No. 82 of 2001.

In Indonesia, the method used for evaluating the quality of water bodies with a water quality index is regulated in the Decree of the Minister of Environment No. 115 of 2003 concerning guidelines for determining the status of water quality. Based on article 2 of the Decree of the Minister of Environment No. 115 of 2003, the water status quality can be determined by the STORET method or the Pollution Index Method (IP) (Aziz 2003).

According to SK SNI M-18-1989-F (1989), it is explained that floods are relatively high flows and are not accommodated by river or channel flows. The flow here is referred to the flow of water whose source can be from anywhere, so that the water comes out of a river or channel because the river and its channel have exceeded its capacity due to flood debit, this condition is called flood.

The planned flood debit can be calculated by using several methods including the empirical relationship between rainfall and runoff. This is the most widely developed method, so that some equations are obtained, namely the rational method. In the Department of Public Works, SK SNI M-18-1989-F (1989), it was explained that the Rational Method could be used for knowing the size of the drainage area <5000 Ha.

Channel section modeling and channel geometry were taken by using the open source QGIS application and the RiverGIS plugin. RiverGIS is a QGIS plugin for creating geometry of the Hec-Ras flow model from spatial data. RiverGIS (Typical RiverGIS) workflow:

HEC-RAS is an application program that integrates graphical user interface features, hydraulic analysis, data management and storage, graphics, and reporting (Istiarto 2014).

1. Create a new database scheme for the model
2. Set the spatial projection of the model
3. Create / import model geometry (river lines, cross sections, hydraulic structures)
4. Build a river network (topology, which is achieving connectivity and order, achieving length)
5. Calculate cross-section attributes (stations, downstream lengths, etc.) and vertical shapes (DTM raster probes)
6. Find Manning roughness coefficient for cross section
7. Determine data across additional sections (embankment, ineffective flow area and barrier)
8. Build hydraulic structures (bridges / culverts, inline and lateral structures, storage areas, etc.).
9. Create the Import GIS - HEC-RAS file

III. Methods Of Study

Analysis of water quality status was taken in four sample points, namely, 1, TS.2, TS.3 and TS.4. The study begins with taking water samples to four sample points, which are then analyzed in the laboratory to get the parameter value to obtain the C_i / L_j value. The value is used to determine the maximum value of C_i / L_j ($(C_i / L_j) M$) and the value Average C_i / L_j ($(C_i / L_j) R$), then proceed with the calculation of pollution index for j (PI_j) designation. Results of the pollution index calculation for the designation of j (PI_j) will determine the condition of water quality in accordance with the Decree of the Minister of Environment No. 115 of 2003 concerning guidelines for determining the status of water quality, namely:

- | | |
|------------------------|---|
| $0 \leq PI_j \leq 1.0$ | → meet quality standards (good condition) |
| $1.0 < PI_j \leq 5.0$ | → lightly polluted |
| $5.0 < PI_j \leq 10$ | → medium polluted |
| $PI_j > 10$ | → heavily polluted |

Research into the causes of floods and inundations that occur begins with data collection consisting of primary data in the form of channel profile measurements and secondary data in the form of DEM maps obtained from <https://scihub.copernicus.eu> and monthly maximum rainfall data obtained from BMKG Banjarbaru. Rainfall data is used for hydrological analysis to obtain flood debit plans with rational methods. The planned debit is in the form of flood debit at 2 years, 5 years, and 10 years.

The obtained debit is used as one of the data in the hec-race application for analyzing the existing hydrodynamic model of the channel by using the lowest flood debit, i.e. flood debit at 2 years return time of 10.94 m³/sec. The largest flood debit at 10 years is 14.66 m³/sec, the debit will be used to analyze the

hydrodynamic model of the channel cross section design if it turns out that the existing channel cannot accommodate the lowest flood debit.

IV. Results And Discussion

As an index-based method, the IP method is built based on two quality indices. The first is the average index (Ci / Li) R. This index shows the average level of pollution of all parameters in one observation. The second is the maximum index (Ci / Li) M. This index shows a dominant type of parameter that causes a decrease in water quality at one observation. The results of river water quality analysis on the surface of Matang Hanau's DIR channel are presented in the following table:

Table 1. Results of Water Quality Analysis

| Parameters | Unit | Location of Sample Collection | | | |
|-----------------------------|-------------|-------------------------------|-------|-------|-------|
| | | TS.1 | TS.2 | TS.3 | TS.4 |
| pH | - | 6.2 | 6.26 | 6.08 | 6.2 |
| Total Suspended Solid (TSS) | mg/L | 10 | 7.5 | 8.8 | 17 |
| Total Dissolved Solid (TDS) | mg/L | 70 | 75 | 69 | 54 |
| Chemical Inorganic | | | | | |
| DO | mg/L | 2.6 | 4.2 | 4.2 | 1.6 |
| BOD | mg/L | 5 | 10 | 8 | 10 |
| COD | mg/L | 44 | 22 | 34 | 60 |
| NO ₃ | mg/L | 1 | 1 | 1 | 1 |
| NO ₂ | mg/L | 0.02 | 0.02 | 0.02 | 0.02 |
| Cadmium (Cd) | mg/L | 0.006 | 0.006 | 0.006 | 0.006 |
| Copper (Cu) | mg/L | 0.033 | 0.033 | 0.033 | 0.033 |
| Chemical Inorganic | | | | | |
| Detergent | µg/L | 115 | 115 | 110 | 110 |
| Microbiology | | | | | |
| E-coli | Total/100mL | 540 | 540 | 23 | 540 |
| Total coliform | Total/100mL | 540 | 540 | 31 | 540 |

Source: In Situ and Laboratory Test Results

Based on the test results, the parameters are used as analytical material to obtain the water quality status by using the pollution index method, while the following results are obtained from the analysis of the quality standard I:

Table 2. Results of Analysis of Water Quality Status on Quality Standards I

| Location | IP Value | Water Quality Status | Debit (m/s) |
|----------|----------|----------------------|-------------|
| TS.I | 3.92 | Lightly Polluted | 0,09 |
| TS.II | 3.92 | Lightly Polluted | 0,11 |
| TS.III | 3.23 | Lightly Polluted | 0,12 |
| TS.IV | 4.22 | Lightly Polluted | 0,04 |

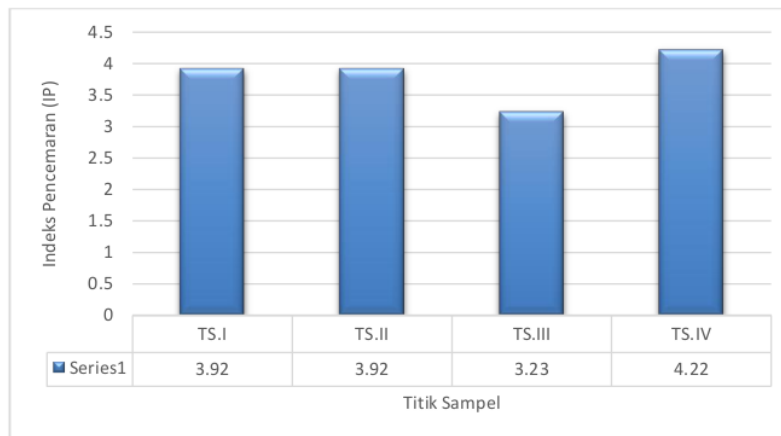


Figure 1. Results of Pollution Index Analysis on Quality Standards I

The analysis indicates that all IP values for all sample points against quality standards are in the range of $1.0 < PI_j \leq 5.0$ which identifies that the water condition in the channel is lightly polluted against the quality standard I as the designation of raw water clean water.

Based on the test results, the parameters are used as analysis material to obtain the status of water quality using the pollution index method, while the obtained results of the analysis of quality standards II are presented in the following table:

Table 3. Results of Analysis of Water Quality Status on Quality Standards II

| Location | IP Value Quality Standard II | Water Quality Status | Debit (m/s) |
|----------|---------------------------------|----------------------|-------------|
| TS.I | 1.89 | Lightly Polluted | 0,09 |
| TS.II | 2.89 | Lightly Polluted | 0,11 |
| TS.III | 2.62 | Lightly Polluted | 0,12 |
| TS.IV | 3,07 | Lightly Polluted | 0,04 |

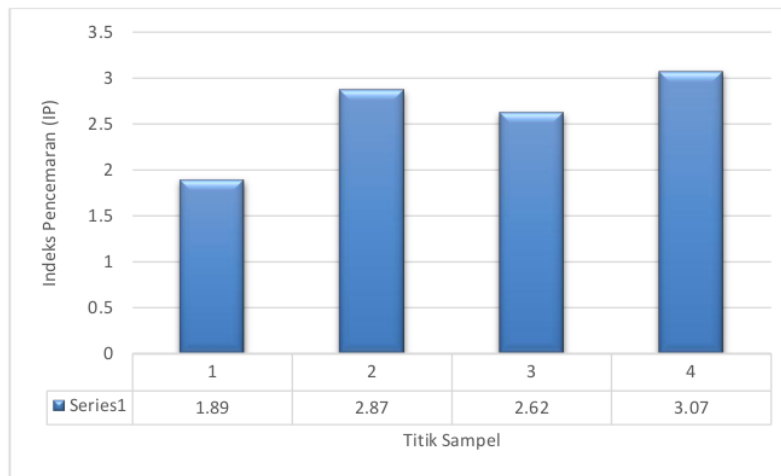


Figure 2. Results of Pollution Index Analysis on Quality Standards II

The analysis indicates that all IP values for all sample points against the quality standard are in the range of $1.0 < PI_j \leq 5.0$ which identifies that the condition of the water in the channel is lightly polluted against the quality standard II as water designated for agricultural and plantation purposes.

The calculation of maximum average daily rainfall is started by sorting the rainfall data from the largest to the smallest at each station. The average rainfall calculation will be presented in table form.

Table 1. Calculation of Average Maximum Daily Rainfall

| No. | Stations | | | Average Rainfall |
|-----|-------------|----------------|---------------|------------------|
| | MurungPudak | South Paringin | North Amuntai | |
| 1 | 174 | 138 | 169 | 160,33 |
| 2 | 131 | 133 | 162 | 142,00 |
| 3 | 120 | 117 | 151 | 129,33 |
| 4 | 115 | 106 | 136 | 119,00 |
| 5 | 113 | 105 | 99 | 105,67 |
| 6 | 87 | 85 | 93 | 88,33 |
| 7 | 78 | 83 | 91 | 84,00 |
| 8 | 78 | 75 | 91 | 81,33 |
| 9 | 40 | 58 | 87 | 61,67 |
| 10 | 33 | 41 | 87 | 53,67 |
| 11 | 33 | 29 | 77 | 46,33 |

The calculation or estimation of the amount of flood debit that will occur in various return periods with good results can be done by the analysis of the Rational Method. Equation $Q = 0.278 \times C \times I_T \times A$. The debit of the rational method plan is presented in Table 5 below:

Table2.Flood Debit Plan Rational Method

| No. | Return (Years) | Periods | A (km ²) | R ₂₄ (mm) | L (km) | H (km) | C | w (km/hour) | tc (mm/hour) | I (mm/hour) | Qt (m ³ /sec) |
|-----|----------------|---------|----------------------|----------------------|--------|--------|-----|-------------|--------------|-------------|--------------------------|
| 1 | 2 | | 10.90 | 112.31 | 5.546 | 0.02 | 0.7 | 0.62 | 8.96 | 9.03 | 10.94 |
| 2 | 5 | | 10.90 | 133.35 | 5.546 | 0.02 | 0.7 | 0.62 | 8.96 | 10.72 | 12.99 |
| 3 | 10 | | 10.90 | 150.44 | 5.546 | 0.02 | 0.7 | 0.62 | 8.96 | 12.09 | 14.66 |

Source :Analysis Results

Evaluation of the existing channel begins with the imitation of channel geometry using the Qgis 2.18.18 application and using model elevation data (DEM) obtained from <https://scihub.copernicus.eu>. Imitation of channel geometry in gis application is supported by rivergis application. The results of geometry imitation can be seen in Figures 3 and 4.

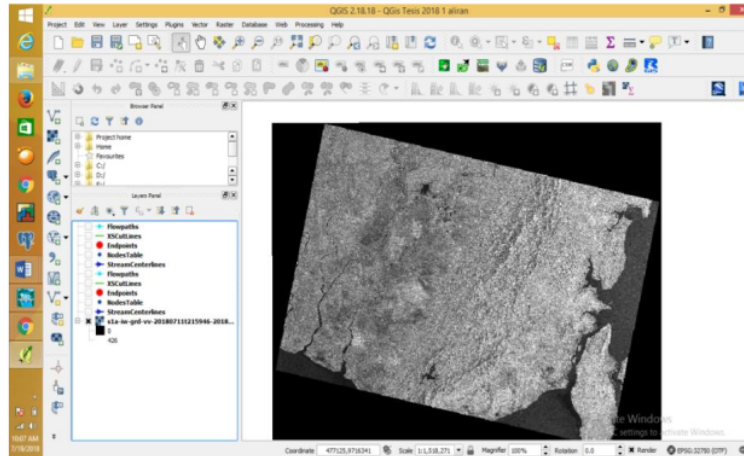


Figure1. DEM Layer (Source: Analysis)

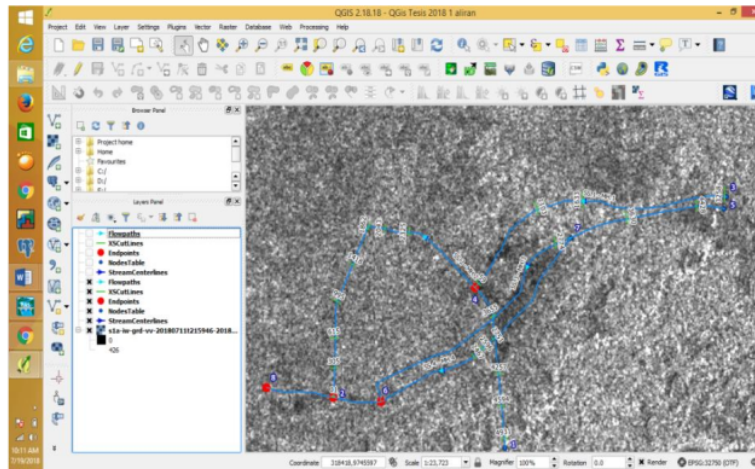


Figure 4. Results of Channel Geometry Imitation (Source: Analysis)

After the channel geometry imitation is complete, the channel geometry is converted to a hec-race file using the RiverGis plugin. The geometry of the converted channel is imported into hec-race as the channel geometry for the hydraulic analysis process, as shown in figure 4.6.

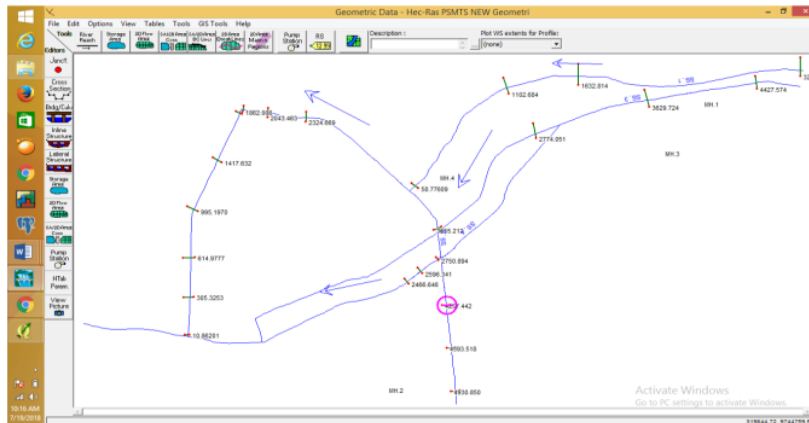
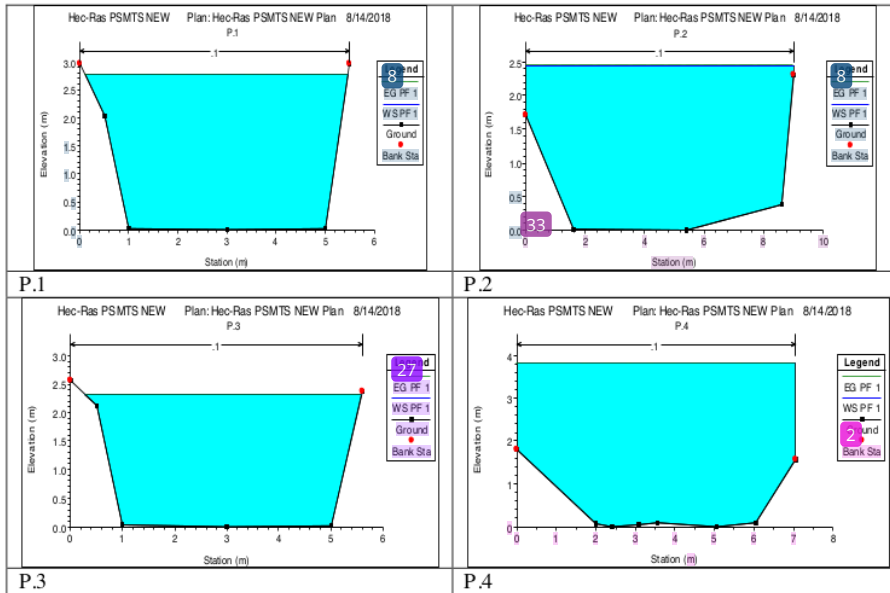


Figure 5. Channel Geometry Results Imported from Qgis (Source: Analysis)

Based on the analysis results by using the rational method, the smallest planned flood debit was 10.94 m³/sec at the 2-years return period (Q₂) and the largest planned flood debit was 14.66 m³/sec in the 10-years return period (Q₁₀).

Hec-Ras simulation was used to predict the condition of the channel section and water level in the existing channel using the smallest discharge. Different roughness values for each channel were reviewed. Roughness values for SS.1, SS.2 and SS. 4 were the flow of grass, deep grooves, or flood paths with trees and shrubs (Very weedy reaches, deep pools, or floodways with heavy stands of timber and brush) in accordance with table II.9 with roughness value of 0.1. Roughness value for SS.3 channel takes form of clean and straight flow, full water level, no gap or deep part (kedung) (clean, straight, full, no rifts or deep pools) with value of 0.030. The results of the existing channel simulation on the smallest plan flood debit are can be seen in Figure 6.



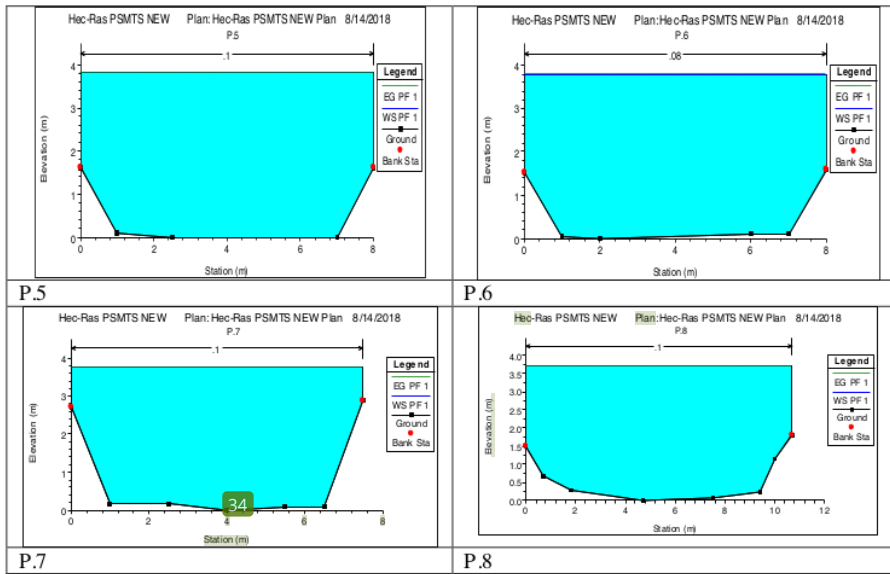


Figure 6. Results of Hec-Race Simulation of Debit Plans Q1

Based on results of the hec-race application simulation with a 2-years return period, all channel sections are unable to accommodate the flood debit, so that a rise in water level exceeds the height of the channel section where it causes flooding in the Matang Hanau swamp irrigation area. Based on the analysis results, it is necessary to redesign the cross section of the channel with a 10-years flood debit.

Based on the design calculation, the channel dimension can accommodate the flood debit plan. Based on the data - design data of channel dimensions and flood debit plan, the simulation was taken with Hec-race application. Simulation results can be seen in the following figure:

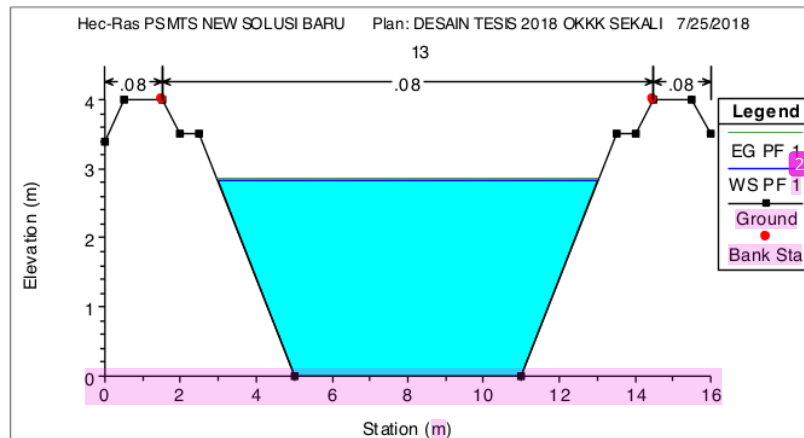


Figure 7. Cross Section Simulation P.1 SS.1-MH.1 (Source: Analysis)

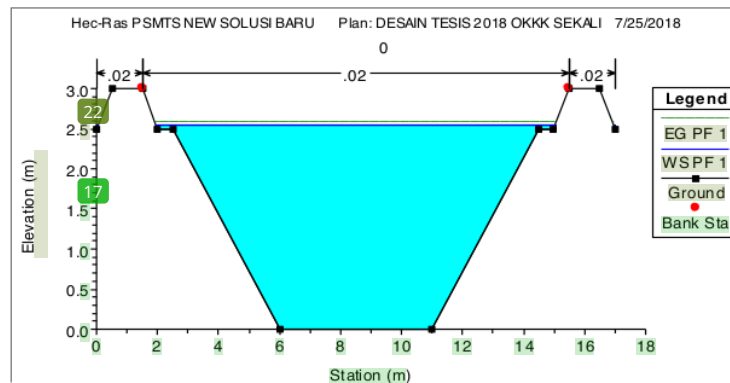


Figure 8. CrossSection Section P.5 SS.2-MH.2 (Source: Analysis)

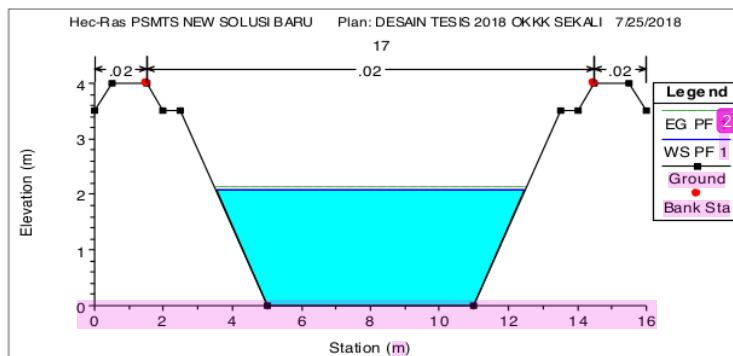


Figure 9. Cross Section Simulation P.18 SS.3-MH.3 (Source: Analysis)

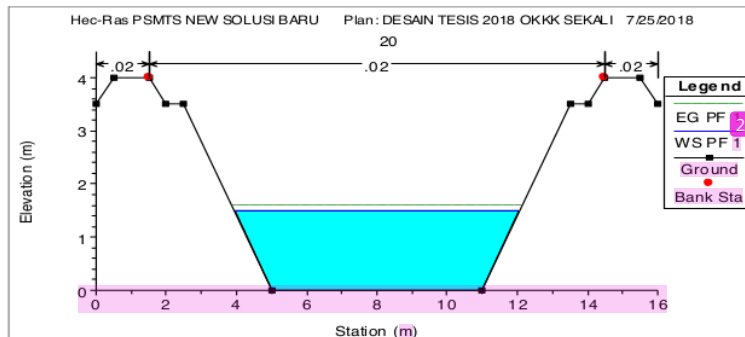


Figure 10. Simulation of Section Section P.21 SS.4-MH.4 (Source: Analysis)

V. Conclusion

Some conclusions can be drawn from the study are as follows:

1. The analysis results suggested that the water quality status at the study site was identified as mildly polluted against quality standard I as raw material for clean water and standard quality II as water for livestock and agriculture.
2. Laboratory test results revealed that the polluted parameters are DO, BOD, COD, Copper and E-Coli.
3. Based on the results of the hec-ras application simulation, it can be seen that the condition of the existing channel cannot accommodate the smallest flood debit plan, which is $2.85\text{m}^3/\text{sec}$. So that the water overflows the channel causing the flooded land due to the exceeded water level in the existing channel crossing capacity.

4. The hydrodynamic model of the Hec-Ras application simulation results shows that the condition of the existing channel section is unable to pass by the planned flood debit.
5. Based on the results of a cross-section redesign, the channel is able to accommodate a 10-years return flood debit (Q_{10}) of $14.66 \text{ m}^3/\text{sec}$.

References

- [1]. Adam Suseno, R.A., 2012. Penggunaan Quantum GIS dalam Sistem Informasi Geografis, Bogor.
- [2]. Arnita Ikke Sari, Bambang Sudarsono, Bandi Sasmita, H., 2013. Penentuan Area Luapan Kali Babon Akibat Kenaikan Debit Air Berbasis Sistem Informasi Geografis. Geodesy Journal. Available at: <http://www.ejournal-s1.undip.ac.id/index.php/geodesi/article/view/3696>.
- [3]. Asdak, C., 2007. Hidrologi dan Pengelolaan Daerah Aliran Sungai, Central Kalimantan: Gadjah Mada University Press.
- [4]. Aziz, L.A., 2003. Evaluasi Status Mutu Sungai Cihampelas Dengan Metode Storet Dan Indeks Pencemaran Use Of Storet Method And Pollutant Index For Water Quality Assessment Of Cihampelas River Faculty of Civil and Environmental Engineering, Bandung Institute of Technology, bada quality status. , pp.1-9.
- [5]. National Standardization Agency, 2015. Tata Cara Pengukuran Debit Aliran Sungai dan Saluran Terbuka Menggunakan Alat Ukur Arus dan Pelampung, Jakarta: BSN.
- [6]. Chow, V. Te, 1997. Hidrolika Saluran Terbuka (Open Channel Hydraulics) Yani Sianipar, ed., Jakarta: Erlangga.
- [7]. Corps, U.A. & Engineers, O., 2016. HEC-RAS River Analysis System, Amerika Serikat: Institute for Water Resources Hydrologic Engineering Center.
- [8]. Diah Ayu Kusumadewi, Ludfi Djakfar, M.B., 2013. Arahan Spasial Teknologi Drainase untuk Mereduksi Genangan di Sub Daerah Aliran Sungai Watu Bagian Hilir.
- [9]. Edinayanti, 2018a. Banjir Menghancurkan Sumber Kehidupan Warga Trans Lajar Papuyuan, Begini Nasib Mereka Sekarang. banjarmasin.tribunnews.com.p.<http://banjarmasin.tribunnews.com/2018/02/17/banjir>. Available at: <http://banjarmasin.tribunnews.com>.
- [10]. Edinayanti, 2018b. Waduh, Warga Trans Lajar Sudah Biasa Mandi dan Cuci Menggunakan Air Bercampur Limbah Manusia.banjarmasin.tribunnews.com. p.<http://banjarmasin.tribunnews.com/2018/02/17/banjir>.
- [11]. Hermawan, C., 2017. Penentuan Status Pencemaran Kualitas Air dengan Metode Storet dan Indeks Pencemaran (Studi Kasus: Sungai Indragiri Ruas Kuantan Tengah). REKAYASA, 7.
- [12]. Istiarto, 2014. Modul Pelatihan Dengan Bantuan Paket Program Hidrodinamika Hec-Ras Jenjang Dasar : Simple Geometry River Istiarto, ed., Yogyakarta: Istiarto.
- [13]. Kamiana, I.M., 2011. Teknik Perhitungan Debit Rencana Bangunan Air 1st ed., Palangkaraya: Graha Ilmu.
- [14]. Kelton, A.M.L.& W.D., 1991. Simulation Modeling & Analysis, second ed. McGraw-Hill, ed.,
- [15]. Kereh, I.E., 2018. Analisis Debit Banjir dan Tinggi Muka Air Sungai Paluas Di Kelurahan Lowu I Kabupaten Minahasa Tenggara. Sipil Statik, 6.
- [16]. Minister of Environment, 2003. KepMENLH no. 115 Tahun 2003 Tentang Pedoman Status Mutu Air, Jakarta: Deputy Minister of Environment and Forestry Policy and Environmental Institutions.
- [17]. Nida, 2018. Hubungan Status Mutu Air Metode Indeks Pencemaran dengan Kegiatan Keramba Jaring Apung di Waduk Riam Kanan Kecamatan Aranio Kabupaten Banjar Provinsi Kalimantan Selatan. Unlam.
- [18]. Nusantoro, R.N., Harisuseno, D. & Suhartanto, E., 2015. Analisis Daerah Genangan Akibat Luapan Sungai Porong Kabupaten Sidoarjo.
- [19]. Government Regulation of the Republic of Indonesia No.82 of 2001. Peraturan Pemerintah Republik Indonesia nomor 82 Tahun 2001 Tentang Pengelolaan Kualitas Air dan Pengendalian Pencemaran Air, Jakarta: Deputy Secretary of the Cabinet for Legal Affairs and Legislation.
- [20]. Rante, N.R., 2016. Analisis Debit Banjir Anak Sungai Tikala Pada Titik Tinjauan Kelurahan Banjar Kecamatan Tikala Dengan Menggunakan HEC-HMS dan HEC-RAS. Tekno, 14.
- [21]. Seyhan, E., 1990. Dasar Dasar Hidrologi, Yogyakarta: Gadjah Mada University Press.
- [22]. Sheftiana, U.S., 2017. Penentuan Status Mutu Air Sungai Berdasarkan Metode Indeks Pencemaran Sebagai Pengendalian Kualitas Lingkungan (Studi Kasus: Sungai Gelis, Kabupaten Kudus, Jawa Tengah). , 6.
- [23]. Sisuantio, D.F., 2017. Studi Penentuan Status Mutu Air Sungai Kuala Dua untuk Keperluan Bahan Baku Air Bersih. Teknologi Lingkungan Lahan Basah.
- [24]. Soemarto, 1986. Hidrologi Teknik Soemarto, ed., Surabaya: Usaha Nasional.
- [25]. Soewarno, 2014. Aplikasi Metode Statistika untuk Analisis Data Hidrologi Soewarno, ed., Yogyakarta: Graha Ilmu.
- [26]. Soewarno, 1995. Hidrologi (Aplikasi Metode Statistik untuk Analisa Data) Jilid 1 1st ed., Bandung: Nova.
- [27]. Suadnya., D.P., 2017. Analisis Debit Banjir dan Tinggi Muka Air Banjir Sungai Sario di Titik Kawasan Citraland. Sipil Statik, 5.
- [28]. Suripin, 2003. Sistem Drainase Perkotaan yang Berkelanjutan, Semarang: Andi Yogyakarta.
- [29]. Suyono Sosrodarsono, K.T., 2003. Hidrologi Untuk Pengairan 3rd ed. K. T. Suyono Sosrodarsono, ed., Jakarta: PT. PRADNYA PARAMITA.
- [30]. Triatmodjo, B., 2015. Hidrologi Terapan 5th ed., Yogyakarta: Beta Offset Yogyakarta.
- [31]. Wahyuningtyas, A., 2017. Pengendalian Banjir Sungai Bringin Semarang. Karya Teknik Sipil, 6.
- [32]. Wigati, R., 2016. Analisis Banjir Menggunakan Software HEC-RAS 4.1 (Studi Kasus Sub DAS Cisimeut Hilir HM 0+00 Sampai dengan HM 69+00). Fondasi, 5.

Chandra Wahyu Sulisty "Analysis Of Water Status Quality And Flood And Inundation Causes In Rawa Matang Hanau Irrigation Area Balangan District "IOSR Journal of Mechanical and Civil Engineering (IOSR-JMCE) , vol. 15, no. 5, 2018, pp. 65-73



IOSR Journals
International Organization
of Scientific Research

*International Organization
Of Scientific Research
Community of Researcher*

Date: 08/September/2018

Dear *Chandra Wahyu Sulisty, Rony Riduan and Hafizh Praselia*

Received your article.

Thank you for contributing your article for publication in IOSR Journals. We appreciate your contribution.

We have forwarded your Paper titled “**Analysis of Water Status Quality and Flood and Inundation Causes in Rawa Matang Hanau Irrigation Area Balangan District**” Author Chandra Wahyu Sulisty, Rony Riduan and Hafizh Praselia, for peer review at *IOSR Journal of Mechanical and Civil Engineering (IOSR-JMCE)* (e-ISSN: 2278-1684, p-ISSN: 2320-334X)

We will be informed about the status of your paper within 4-7 weeks, after peer review process.

Your manuscript id is **E36174**. Please use this id for further information about this article.

We will let you know if you have to make any modification as per the editor’s comments. If the corrections are minor we will made it at our end only. Editorial decision will be intimated to you soon.

You can check your paper status through following link <http://www.iosrjournals.org/iosr-jmce/pages/check-paper-status.html>



**With Warm Regards,
Editorial Board,
IOSR Journals
International Organization of Scientific Research (IOSR)**



Analysis Of Water Status Quality And Flood And Innundation

ORIGINALITY REPORT

18%

SIMILARITY INDEX

14%

INTERNET SOURCES

9%

PUBLICATIONS

7%

STUDENT PAPERS

PRIMARY SOURCES

| | | |
|---|--|----|
| 1 | Submitted to MidAmerica Nazarene University Student Paper | 2% |
| 2 | allegatiatti.comune.lucca.it Internet Source | 1% |
| 3 | E Kurniawan, S Sumaryo, F Budiman, A Happy, B S Aprillia. "Design and implementation of the quality of mineral water test equipment using fuzzy logic method based on Internet of Things", IOP Conference Series: Materials Science and Engineering, 2021 Publication | 1% |
| 4 | repository.ubharajaya.ac.id Internet Source | 1% |
| 5 | www.ajer.org Internet Source | 1% |
| 6 | www.gssrr.org Internet Source | 1% |
| 7 | businessdocbox.com Internet Source | 1% |

| | | |
|----|---|-----|
| 8 | Submitted to Universiti Malaysia Sabah Student Paper | 1 % |
| 9 | www.aes.bioflux.com.ro Internet Source | 1 % |
| 10 | nepis.epa.gov Internet Source | 1 % |
| 11 | D C N Doloksaribu, T A Barus, K Sebayang. "The impact of marine sand mining on sea water quality in Pantai Labu, Deli Serdang Regency, Indonesia", IOP Conference Series: Earth and Environmental Science, 2020 Publication | 1 % |
| 12 | garuda.ristekbrin.go.id Internet Source | 1 % |
| 13 | www.caee.utexas.edu Internet Source | 1 % |
| 14 | Ari Kusumawardhani, Dwita Sutjiningsih, Evi Anggraheni. "Effectivity of micro drainage system as part of macro drainage system: A case study of Kelapa Gading, North Jakarta", MATEC Web of Conferences, 2019 Publication | 1 % |
| 15 | Achmad Syarifudin, Alfrendo Satyanaga, Henggar Risa Destania. "Application of the HEC-RAS Program in the Simulation of the | 1 % |

Streamflow Hydrograph for Air Lakitan Watershed", Water, 2022

Publication

16

Wiwik Widyaningrum, Margaretha Widyastuti. "Effects of Liquid Wastes from Tofu Industries on Water Quality in Parangan River, Magelang District, Central Java-Indonesia", E3S Web of Conferences, 2021

Publication

1 %

17

www.comune.massa-e-cozzile.pt.it

Internet Source

<1 %

18

eprints.unm.ac.id

Internet Source

<1 %

19

Ni Nyoman Adum M. "Evaluation Study of Kedunglarangan River To Protect Flood In Pasuruan and Sidoarjo", Journal of Applied Science, Engineering, Technology, and Education, 2019

Publication

<1 %

20

theses.uin-malang.ac.id

Internet Source

<1 %

21

Amri Danades, Devie Pratama, Dian Anggraini, Diny Anggriani. "Comparison of accuracy level K-Nearest Neighbor algorithm and Support Vector Machine algorithm in classification water quality status", 2016 6th International

<1 %

Conference on System Engineering and Technology (ICSET), 2016

Publication

22

Submitted to Universiti Kebangsaan Malaysia

Student Paper

<1 %

23

repository.up.ac.za

Internet Source

<1 %

24

Lies Kurniawati Wulandari, M Bisri, Donny Harisuseno, Emma Yuliani. "Abilities of stratified filter and wetland to reduce TDS and TSS in blackwater domestic waste", IOP Conference Series: Materials Science and Engineering, 2019

Publication

<1 %

25

Rika Ernawati, Herlando Bubala, Tedy Agung Cahyadi, Waterman Sulistyana Bargawa, Nurkhamim. "The management and control of water overflows from the settling ponds to coastal waters in PT. X", AIP Publishing, 2020

Publication

<1 %

26

Rina Febrina, Abu Bakar Sambah. "The impact of land use on water quality using geospatial approach (a case study in Way Kuripan River watershed)", AIP Publishing, 2019

Publication

<1 %

27

docplayer.rs

Internet Source

<1 %

28

www.orientjchem.org

Internet Source

<1 %

29

D'Oria, Marco, Paolo Mignosa, and Maria Giovanna Tanda. "An inverse method to estimate the flow through a levee breach", *Advances in Water Resources*, 2015.

Publication

<1 %

30

Zainal Wahyu, Syarifah Melly Maulina, Muji Listyo Widodo. "ANALISIS KUALITAS AIR DAERAH IRIGASI LUBUK ANTUK KECAMATAN HULU GURUNG KABUPATEN KAPUAS HULU", *Jurnal TEKNIK-SIPIL*, 2020

Publication

<1 %

31

ecampus.sttind.ac.id

Internet Source

<1 %

32

journal.ugm.ac.id

Internet Source

<1 %

33

www.comune.cerveteri.rm.it

Internet Source

<1 %

34

www.comune.piombino.li.it

Internet Source

<1 %

35

www.ijerms.com

Internet Source

<1 %

36

Rini Wahyu Sayekti, Muhammad Amar Sajali, Indah Tri Wahyuni. "Conservative management of Lahor Reservoir based on

<1 %

eutrophication conditions due to fish farming
and agriculture waste", IOP Conference
Series: Earth and Environmental Science, 2020

Publication

37

www.e3s-conferences.org

Internet Source

<1 %

Exclude quotes Off

Exclude matches Off

Exclude bibliography On